

## 5200 Buhler 435, 485, & 535

## **Undercarriage Installation Instructions**


## **Caution:**

- Always use precaution when working around any equipment.
- Always wear safety glasses.
- Follow tractor manufacture's safety guidelines when installing this product.
  - 1. Read all instructions prior to installation.
  - 2. Remove weights and weight bracket from front of tractor if necessary.
  - 3. Remove front toolbox/step.
  - **4.** Position the undercarriage (U/C) under the tractor and center with the frame of the tractor.
  - **5.** Remove the 2 bolts from below and behind the front transmission mount. Keep the bolts, washers and nuts for attaching the U/C.
  - **6.** Enlarge existing holes on the front sides of the tractor frame for the 1" bolts. See attached diagram for clarification.
  - **7.** Lift the U/C and push back until the U/C is firmly against the transmission mount.
  - **8.** Attach the rear of the U/C to the tractor frame with the previously removed bolts, washers and nuts.
  - **9.** Install 5 1" x 3" bolts (PN: 16-20562) with a 1" ID washer (PN: 57-3682) on each bolt through the side holes of the U/C and into the holes of the tractor. See attached diagram for clarification.
- **10.** After all 10 bolts are through the tractor frame, attach with a 1" ID washer (PN: 57-3682) and 1" nut (PN: 70-20599) on each bolt.
- **11.** Verify that the U/C is tight up against the front transmission mount.
- **12.** Torque the rear bolts to the tractor manufacture's torque specifications and the 1" bolts to 903 ft-lbs.
- **13.** Using the side frame holes as guides, drill a 1" hole on each side of the tractor for the remaining bottom, center hole of the U/C. See attached diagram for clarification.
  - Caution: When drilling, be aware of all parts behind the material being drilled so that you do not mistakenly hit or puncture components on engine side of tractor frame.
- **14.** Use 1 1" x 3" bolt (PN: 16-20562), 2 1" ID washers (PN: 57-3682), and a 1" nut (PN: 70-20599) in the previously drilled holes on each side of the tractor.
- **15.** Torque the last 2 1" bolts to 903 ft-lbs.
- **16.** After first 8 hours of use, re-torque all bolts.
- 17. Check all fasteners regularly to ensure proper operation of equipment.

PN: 63-5180-A Date: 10-17-2006





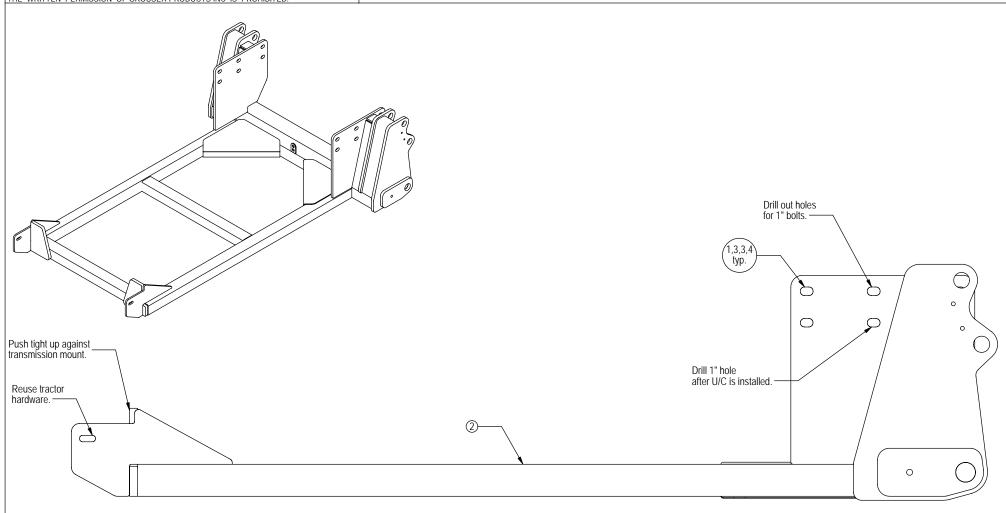

Item No.	Qty.	Part Number	Description
1	12	16-20562	1" X 3" Hex Bolt Gr8 NC
2	1	54-5180	5200 Buhler 435, 485, 535 Undercarriage
3	24	57-3682	1.00" ID x 2-1/2" OD x .375" Heavy Washer CZ Plated
4	12	70-20599	1" Hex Nut Gr 8 NC

G	GROUSER PRODUCTS INC.			
	755 2nd Ave NW West Fargo, ND, 58078	Phone 701.282.7710 Fax 701.282.8131		

West Fargo, ND 58078 WWW.GROUSER.COM

DWG. NO. 5180-A

Buhler 435, 485, 535 Date: Scale:

4-18-2006 1:12

Sheet: